

Application manual Navigator



Trace back information: Workspace R16-1 version a2 Checked in 2016-02-26 Skribenta version 4.6.209

Application manual Navigator

Document ID: 3HAC050962-001 Revision: A

© Copyright 2004-2016 ABB. All rights reserved.

The information in this manual is subject to change without notice and should not be construed as a commitment by ABB. ABB assumes no responsibility for any errors that may appear in this manual.

Except as may be expressly stated anywhere in this manual, nothing herein shall be construed as any kind of guarantee or warranty by ABB for losses, damages to persons or property, fitness for a specific purpose or the like.

In no event shall ABB be liable for incidental or consequential damages arising from use of this manual and products described herein.

This manual and parts thereof must not be reproduced or copied without ABB's written permission.

Additional copies of this manual may be obtained from ABB.

The original language for this publication is English. Any other languages that are supplied have been translated from English.

© Copyright 2004-2016 ABB. All rights reserved.

ABB AB Robotics Products Se-721 68 Västerås Sweden

Table of contents

	Over	view of this manual	7
	Prod	uct documentation, IRC5	8
		y	10
1 Introduction			11
2	Installation		13
	2.1	Software set-up	13
		2.1.1 System parameters	13
		2.1.2 Loading software	14
3	User scenarios		
	3.1	Navigator for calibration	15
	3.2	Examples	16
		3.2.1 Rotational axis calibration	16
		3.2.2 Fixture/workobject calibration	17
		3.2.3 Navigator for coordinate measurements	18
4	RAPID references		
	4.1	Instructions	21
		4.1.1 SearchSpL - move linear search sphere	21
		4.1.2 SearchSpJ - move joint search sphere	25
		4.1.3 Measure_1D - one-dimensional measurement	29
	4.2	Data types	33
		4.2.1 navgeodata - Navigator geometrical data	33
Ind	dex		35

This page is intentionally left blank

Overview of this manual

About this manual

This manual explains the basics of when and how to use the option Navigator:

- Product overview
- Operation overview
- Requirements overview
- · Software set-up
- Software reference, RAPID

Usage

This manual can be used either as a reference to find out if an option is the right choice for solving a problem, or as a description of how to use an option. Detailed information regarding syntax for RAPID routines, and similar, is not described here, but can be found in the respective reference manual.

Who should read this manual?

This manual is intended for:

- installation personnel
- robot programmers

Prerequisites

The reader should...

- · be familiar with industrial robots and their terminology
- be familiar with the RAPID programming language
- be familiar with system parameters and how to configure them.

Reference documents

References	Document ID
Technical reference manual - RAPID overview	3HAC050947-001
Technical reference manual - RAPID Instructions, Functions and Data types	3HAC050917-001
Operating manual - Getting started, IRC5 and RobotStudio	3HAC027097-001
Operating manual - IRC5 with FlexPendant	3HAC050941-001
Technical reference manual - System parameters	3HAC050948-001
Operating manual - RobotStudio	3HAC032104-001
Application manual - Production Manager	3HAC052855-001

Revisions

Revision	Description
-	Released with RobotWare 6.0.
Α	Minor corrections.

Product documentation, IRC5

Categories for user documentation from ABB Robotics

The user documentation from ABB Robotics is divided into a number of categories. This listing is based on the type of information in the documents, regardless of whether the products are standard or optional.

All documents listed can be ordered from ABB on a DVD. The documents listed are valid for IRC5 robot systems.

Product manuals

Manipulators, controllers, DressPack/SpotPack, and most other hardware is delivered with a **Product manual** that generally contains:

- Safety information.
- Installation and commissioning (descriptions of mechanical installation or electrical connections).
- Maintenance (descriptions of all required preventive maintenance procedures including intervals and expected life time of parts).
- Repair (descriptions of all recommended repair procedures including spare parts).
- Calibration.
- Decommissioning.
- Reference information (safety standards, unit conversions, screw joints, lists of tools).
- Spare parts list with exploded views (or references to separate spare parts lists).
- Circuit diagrams (or references to circuit diagrams).

Technical reference manuals

The technical reference manuals describe reference information for robotics products.

- *Technical reference manual Lubrication in gearboxes*: Description of types and volumes of lubrication for the manipulator gearboxes.
- *Technical reference manual RAPID overview*: An overview of the RAPID programming language.
- Technical reference manual RAPID Instructions, Functions and Data types: Description and syntax for all RAPID instructions, functions, and data types.
- *Technical reference manual RAPID kernel*: A formal description of the RAPID programming language.
- *Technical reference manual System parameters*: Description of system parameters and configuration workflows.

Continued

Application manuals

Specific applications (for example software or hardware options) are described in **Application manuals**. An application manual can describe one or several applications.

An application manual generally contains information about:

- The purpose of the application (what it does and when it is useful).
- What is included (for example cables, I/O boards, RAPID instructions, system parameters, DVD with PC software).
- How to install included or required hardware.
- How to use the application.
- Examples of how to use the application.

Operating manuals

The operating manuals describe hands-on handling of the products. The manuals are aimed at those having first-hand operational contact with the product, that is production cell operators, programmers, and trouble shooters.

The group of manuals includes (among others):

- Operating manual Emergency safety information
- Operating manual General safety information
- Operating manual Getting started, IRC5 and RobotStudio
- Operating manual Introduction to RAPID
- Operating manual IRC5 with FlexPendant
- Operating manual RobotStudio
- Operating manual Trouble shooting IRC5, for the controller and manipulator.

Safety

Safety of personnel

When working inside the robot controller it is necessary to be aware of voltage-related risks.

A danger of high voltage is associated with the following parts:

- Devices inside the controller, for example I/O devices, can be supplied with power from an external source.
- The mains supply/mains switch.
- The power unit.
- The power supply unit for the computer system (230 VAC).
- The rectifier unit (400-480 VAC and 700 VDC). Capacitors!
- The drive unit (700 VDC).
- The service outlets (115/230 VAC).
- The power supply unit for tools, or special power supply units for the machining process.
- The external voltage connected to the controller remains live even when the robot is disconnected from the mains.
- Additional connections.

Therefore, it is important that all safety regulations are followed when doing mechanical and electrical installation work.

Safety regulations

Before beginning mechanical and/or electrical installations, ensure you are familiar with the safety regulations described in *Operating manual - General safety information*¹.

¹ This manual contains all safety instructions from the product manuals for the manipulators and the controllers.

1 Introduction

Product overview

Navigator is a set of functions for defining calibration points automatically and for coordinate measurements.

The available services consist of:

- Automatically localize tooling balls.
- · Automatically perform measurement of coordinates on planes.

Operation overview

Navigator consists of a suite of movement instructions in RAPID. The instructions are programmed in traditional RAPID programming manner. Each instruction moves the measurement probe to the search start position and starts a search pattern.

System prerequisites

This Navigator version is intended for use in arc welding systems incorporating IRB 1400, 1600, 2400, etc. robots.

- RobotWare requirements: 5.07 or later
- Controller requirements: IRC5

The Navigator package includes software that is loaded into all arc welding motion tasks. Process configuration parameters are used to connect real I/O signals and to modify the default settings.

Hardware prerequisites

The robot should be equipped with a tactile measurement system such as SmarTac or any other system that sets an I/O signal upon contact with a surface.

The TCP should be a well-defined machine tool probe (ABB option BullsEye is preferred for defining the accurate TCP).

User prerequisites

Any competent robot programmer (RAPID language) may be self-taught to program and use Navigator.

This page is intentionally left blank

2 Installation

2.1 Software set-up

2.1.1 System parameters

Navigator I/O connections together with additional settings for navigator are configured in the process configuration database (PROC). Actual I/O assignments to real I/O boards are not made by the Navigator installation. The user or system designer must add these definitions to the EIO configuration database.

Below is the default proc configuration loaded by Navigator. There is a separate configuration for each task.

The search sensitivity can be adjusted by using by modifying the Max error coarse search and Max error fine search parameters. To change these settings, RobotStudio is preferably used. Default values are 1 mm for coarse search and 0.2 mm for fine search. It is also possible to load an altered proc.cfg, the "Add or Replace" feature in RobotStudio must then be used to override the existing fields with the new settings.



Note

Navigator does not install any I/O signals in the EIO configuration. It provides only a mechanism to connect to existing signals in the system. If the robotic system is not a turnkey system, I/O signals will need to be installed in the system.

2.1.2 Loading software

2.1.2 Loading software

The software is loaded automatically when the option Navigator is purchased for RobotWare.

3 User scenarios

3.1 Navigator for calibration

General

At installation of robot cells a manual calibration of the relationships between the robot and the external axes, fixtures etc must be performed.



It is very critical to do this step as accurate as possible due to that all robot programs will depend on it.

The calibration process

The calibration process is usually done by localizing calibration points using the robot as measurement system.

Navigator is an automated, very accurate and user independent technique that replaces these manual steps.

The standard idea of localizing calibration points is used by Navigator as well. However, instead of letting the user manually point out positions the robot is equipped with a tool equipped with a tooling ball in the end (called a probe) and the robot cell is prepared with mounting holes on the fixture for tooling balls.

The calibration is performed by letting the robot locate tooling balls placed in the holes on the fixture. Thus, the manual step of pointing out reference positions for calibration is replaced by automated search methods. The calibration points nominal positions are prepared in advance in an off-line programming environment and are not updated on the real the system.

The sensor mechanism is tactile, i.e. the touch between objects is determined and causes the robot to stop.

3 User scenarios

3.2.1 Rotational axis calibration

3.2 Examples

3.2.1 Rotational axis calibration

Procedure

The basic method to calibrate a rotational external axis is to localize the same position at the turntable or other fixed structure on the external axis at different rotation angles.

The steps to perform the calibration with Navigator consist of:

	Action
1	Prepare off-line calibration points, i.e. give rough estimates where the points are loc- ated. This is easily done in an off-line programming environment such as RobotStudio but can also be done online. Three to ten targets are required. The same tooling ball should be localized, only the external axis angle should be changed between the points.
2	Attach the probe to robot and calibrate its TCP (BullsEye TM preferred).
3	Run calibration procedure, i.e. use the Navigator instruction $\tt SearchSpL$ with the prepared targets as arguments.
4	Calculate the base frame by using the RAPID instruction CalcRotAxisFrame.
5	Restart the controller.

3.2.2 Fixture/workobject calibration

3.2.2 Fixture/workobject calibration

Procedure

A fixture/workobject can be calibrated in multiple ways. Either use points describing the origin, the x and the y-axis of the coordinate system or more flexible, use any known points in the local object coordinate system. Theses points are usually derived from CAD.

The latter case is calibrated with Navigator in the following steps:

	Action
1	Prepare off-line calibration points, i.e. give rough estimates where the points are loc- ated. This is easily done in an off-line programming environment such as RobotStudio but can also be done online. Three to ten targets are required.
2	Attach the probe to robot and calibrate its TCP (BullsEye TM preferred).
3	Run calibration procedure, i.e. use the Navigator instruction $\tt SearchSpL$ with the off-line prepared targets as arguments.
4	Calculate the base frame by using the RAPID instruction DefAccFrame.

3 User scenarios

3.2.3 Navigator for coordinate measurements

3.2.3 Navigator for coordinate measurements

	The instruction Measure_1D can be used for various coordinate measurement
	tasks. Below are two examples.
Fixture cloning	
	Assume that several identical robot cells are to be manufactured. Each cell has a fixture that needs to be mechanically adjusted.
	The first fixture called the master fixture is created and manually adjusted. The robot is then used to measure a number of reference points (surfaces). The points measured on the master fixture are called nominal points.
	After the nominal points have been defined the master fixture is removed and a clone fixture is mounted in the same robot cell.
	The robot is then ordered to measure the same coordinates on the new not mechanically adjusted fixture. The reference points are compared to the nominal points and a report describing how the clone fixture should be mechanically adjusted is created.
	This procedure can be repeated for unlimited number of clone fixtures.
Production batcl	h monitoring
	To supervise trends of manufactured parts a number of coordinates are measured on a master part. Subsequent parts/batches are thereafter checked periodically

on a master part. Subsequent parts/batches are thereafter checked periodically for deviation from the master part by letting Navigator measure the same coordinates and compare them to the master.

The result is logged and production can be stopped if the deviation is too large.

3.2.3 Navigator for coordinate measurements *Continued*

Workflow

1

The workflow to run coordinate measurement using Navigator comprises of the following steps:

Action
Create robot program.
Below is an example with five measurement points.
MODULE Fixture_LineUp
! GAP declarations
CONST menudata mdCMMSetNominal := ["Setup Nominal Fixture
Points", "", "SetNominal", 3, "T_ROB1", GAP_SHOW_ALWAYS, TRUE, GAP_SETUP_TYPE, 255, FALSE];
CONST menudata mdCMMRunBatch := ["Measure Fixture", "", "Run-
Batch", 3, "T_ROB1", GAP_SHOW_ALWAYS, TRUE, GAP_SER- VICE_TYPE, 255, FALSE];
! Position declarations
CONST robtarget ViaPoint1;
CONST robtarget ViaPoint2;
CONST robtarget ViaPoint3;
CONST robtarget ViaPoint4;
CONST robtarget ViaPoint5;
PERS robtarget rtAppPoint1;
PERS robtarget rtAppPoint2;
PERS robtarget rtAppPoint3;
PERS robtarget rtAppPoint4;
PERS robtarget rtAppPoint5;
PERS robtarget rtNomPoint1;
PERS robtarget rtNomPoint2;
PERS robtarget rtNomPoint3;
PERS robtarget rtNomPoint4;
PERS robtarget rtNomPoint5;
! Program data declarations
PERS tooldata tProbe;
PROC RunRCMM()
MoveJ ViaPoint1,v200,fine,tProbe;
<pre>Measure_1D rtAppPoint1, rtNomPoint1, v100, tProbe, 50, Measure- Name:="CMM1";</pre>
<pre>MoveJ ViaPoint2,v200,fine,tProbe;</pre>
<pre>Measure_1D rtAppPoint2, rtNomPoint2, v100, tProbe, 50, Measure- Name:="CMM2";</pre>
<pre>MoveJ ViaPoint3,v200,fine,tProbe;</pre>
<pre>Measure_1D rtAppPoint3, rtNomPoint3, v100, tProbe, 50, Measure- Name:="CMM3";</pre>
<pre>MoveJ ViaPoint4,v200,fine,tProbe;</pre>
<pre>Measure_1D rtAppPoint4, rtNomPoint4, v100, tProbe, 50, Measure- Name:="CMM4";</pre>
<pre>MoveJ ViaPoint5,v200,fine,tProbe;</pre>
<pre>Measure_1D rtAppPoint5, rtNomPoint5, v100, tProbe, 50, Measure- Name:="CMM5";</pre>

19

3.2.3 Navigator for coordinate measurements *Continued*

	Action
	ENDPROC
	ENDMODULE
2	Create nominal points.
	Execute RunRCMM, accessed from GAP Setup dialog.
3	Run batches.
	Execute RunRCMM, accessed from GAP Service dialog.
4	Evaluate result.

A log in WebWare will be created. Result will also be displayed on the FlexPendant if running in manual mode.

4.1.1 SearchSpL - move linear search sphere

4 RAPID references

4.1 Instructions

4.1.1 SearchSpL - move linear search sphere

Usage	SearchSpL is used for spiral search to localize the exact position of a sphere center given the nominal/CAD position. The movement to reach the approach
	position is performed linearly.
Basic example	SearchSpL nDist, rtResult, rtToPoint,v500, fine, tTool, spData;
	The robot moves linearly to the distance nDist above rtToPoint. At the position the robot starts spiral searches with relatively high search speed until four successful hits of the sphere. The high-speed searches are followed by four accurate searches with low speed to determine the exact location of the sphere center. The robtarget rtResult is updated with the search result.
Arguments	
	ApprDist SearchPoint ToPoint Speed Zone Tool [\WObj] SphereData [\MeanError] [\MaxError] [\UpdateToPoint] [\SearchName] [\TLoad]
ApprDist	
	Data type: num
	The distance above ToPoint where the searches will start. The direction of the distance is defined so that the tool orientation coincide with the normal to the surface where the sphere is mounted.
SearchPoint	
	Data type: robtarget
	The result of the sphere localization, i.e. the exact physical location of the sphere expressed in Wobj.
ToPoint	
	Data type: robtarget
	The nominal position of the sphere center that should be localized oriented such as the tool orientation coincide with the normal to the surface where the sphere is mounted.
Speed	
	Data type: speeddata
	The speed data used when moving to ToPoint . The velocity of the search motion is unaffected.
Zone	
	Data type: zonedata
	Continues on next page

21

4 RAPID references


4.1.1 SearchSpL - move linear search sphere *Continued*


- 1	The zone data used when moving to ToPoint.
Tool	Data type: tooldata The tool used during the search. Both TCP and tool orientation must be valid.
[\WObj]	Data type: wobjdata The work object used during the search. If not selected, wobj0 is used.
SphereData	Data type: navgeodata The definition of radius of the sphere and the search radius.
[\MeanError]	Data type: num The mean error of the different searches compared to the final (localized) position.
[\MaxError]	Data type: num The max error of the different searches compared to the final (localized) position.
[\UpdateToPoint]	Data type: switch If on, the ToPoint will be updated with the search result SearchPoint.
[\SearchName]	Data type: string The name of the search that will be logged if the option Production Monitoring is
[\TLoad]	used. Data type: loaddata
	The \TLoad argument describes the total load used in the movement. The total load is the tool load together with the payload that the tool is carrying. If the \TLoad argument is used, then the loaddata in the current tooldata is not considered.
	If the \TLoad argument is set to load0, then the \TLoad argument is not considered and the loaddata in the current tooldata is used instead. For a complete description of the TLoad argument, see MoveL in Technical reference manual - RAPID Instructions, Functions and Data types.
Program execution	The robot moves linearly to the distance nDist above rtToPoint. The nominal position rtToPoint must have an orientation so that the tool orientation coincides with the normal to the surface where the sphere is mounted. Thus, it is important to not only have a correct TCP but also tool orientation.
	At the position the robot starts spiral searches. First a number of coarse searches with relatively high speed.

Continues on next page

4.1.1 SearchSpL - move linear search sphere *Continued*

The coarse search pattern is a segmented spiral search, i.e. a spiral with linear movements. The height above the surface is constant but gradually decreased if no object is found. When the object is found, the robot regains and a new start position is calculated randomly ensuring that not the same contact position is used twice. When four hits are established the coarse location of the sphere is set and four fine searches with low speed follows.

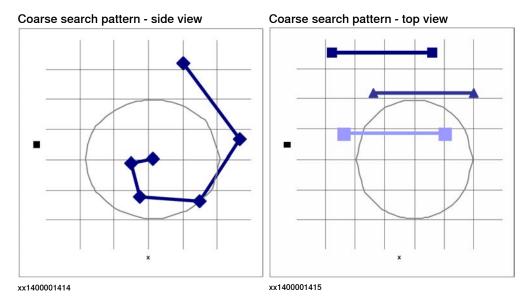

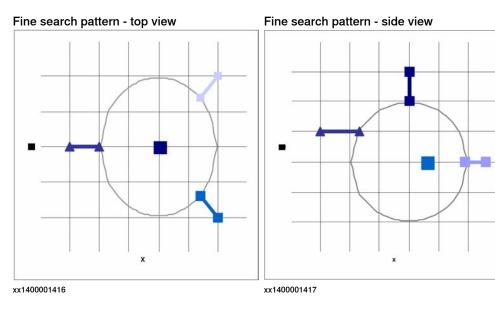

More examples

! Data declarations
PERS robtarget ViaPoint1;
PERS robtarget ViaPoint2;
PERS robtarget rtNomPoint1;
PERS robtarget rtNomPoint2;
PERS robtarget rtResult1;
PERS robtarget rtResult2;

Continues on next page

4 RAPID references

4.1.1 SearchSpL - move linear search sphere *Continued*

```
CONST navgeodata spData:=[6.35, 20.0];
VAR num nDist:=20;
PERS tooldata tProbe;
PROC CreateCalPoints ()
MoveJ ViaPoint1,v200,fine,tProbe;
SearchSpL nDist, rtResult1, rtNomPoint1, v500, fine, tProbe,
spData \SearchName:="CalPoint1";
MoveJ ViaPoint2,v200,fine,tProbe;
SearchSpL nDist, rtResult2, rtNomPoint2, v500, fine, tProbe,
spData \SearchName:="CalPoint2";
ENDPROC
```

Syntax

SearchSpL

```
[ ApprDist ':=' ] < expression (IN) of num > ','
[ SearchPoint ':=' ] < expression (INOUT) of robtarget > ','
[ ToPoint ':=' ] < expression (PERS) of robtarget > ','
[ Speed ':=' ] < persistent (IN) of speeddata > ','
[ Tool ':=' ] < persistent (PERS) of tooldata >
[ '\' WObj ':=' < persistent (PERS) of wobjdata > ]
[ SphereData ':=' < expression (IN) of navgeodata > ]
[ '\' MeanError ':=' < expression (INOUT) of num > ]
[ '\' MaxError ':=' < expression (INOUT) of num > ]
[ '\' UpdateToPoint]
[ '\' SearchName ':=' < expression (IN) of string > ]
[ '\' TLoad ':=' ] < persistent (PERS) of loaddata > ] ';'
```

Related information

	Described in:
CalcRotAxisFrame	Technical reference manual - RAPID Instructions, Functions and Data types
DefAccFrame	Technical reference manual - RAPID Instructions, Functions and Data types
MoveL	Technical reference manual - RAPID Instructions, Functions and Data types
Definition of loaddata	Technical reference manual - RAPID Instructions, Functions and Data types

4.1.2 SearchSpJ - move joint search sphere

4.1.2 SearchSpJ - move joint search sphere

Usage	
	SearchSpJ is used for spiral search to localize the exact position of a sphere center given the nominal/CAD position. The movement to reach the approach position does not have to be in a straight line.
Example	
	SearchSpJ nDist, rtResult, rtToPoint,v500, fine, tTool, spData; The robot moves to the distance nDist above rtToPoint. At the position the robot starts spiral searches with relatively high search speed until four successful hits of the sphere. The high-speed searches are followed by four accurate searches with low speed to determine the exact location of the sphere center. The robtarget rtResult is updated with the search result.
Arguments	ApprDist SearchPoint ToPoint Speed Zone Tool [\WObj] SphereData [\MeanError] [\MaxError] [\UpdateToPoint] [\SearchName] [\TLoad]
ApprDist	
	Data type: num
	The distance above ToPoint where the searches will start. The direction of the distance is defined so that the tool orientation coincide with the normal to the surface where the sphere is mounted.
SearchPoint	
	Data type: robtarget
	The result of the sphere localization, i.e. the exact physical location of the sphere expressed in Wobj.
ToPoint	
	Data type: robtarget
	The nominal position of the sphere center that should be localized oriented such as the tool orientation coincide with the normal to the surface where the sphere is mounted.
Speed	
	Data type: speeddata
	The speed data used when moving to ToPoint . The velocity of the search motion is unaffected.
Zone	
	Data type: zonedata
	The zone data used when moving to ToPoint.
Tool	
	Data type: tooldata

25


4 RAPID references


4.1.2 SearchSpJ - move joint search sphere *Continued*

	The tool used during the search. Both TCP and tool orientation must be valid.
[\WObj]	Data type: wobjdata The work object used during the search. If not selected, wobj0 is used.
SphereData	Data type: navgeodata
[\MeanErrer]	The definition of radius of the sphere and the search radius.
[\MeanError]	Data type: num The mean error of the different searches compared to the final (localized) position.
[\MaxError]	Data type: num
[\UpdateToPoint]	The max error of the different searches compared to the final (localized) position.
	Data type: switch If on, the ToPoint will be updated with the search result SearchPoint.
[\SearchName]	Data type: string The name of the search that will be logged if the option Production Monitoring is used.
[\TLoad]	
	Data type: loaddata The \TLoad argument describes the total load used in the movement. The total load is the tool load together with the payload that the tool is carrying. If the \TLoad argument is used, then the loaddata in the current tooldata is not considered.
	If the \TLoad argument is set to load0, then the \TLoad argument is not considered and the loaddata in the current tooldata is used instead. For a complete description of the TLoad argument, see MoveL in Technical reference manual - RAPID Instructions, Functions and Data types.
Program execution	
	The robot moves to the distance nDist above rtToPoint. The nominal position rtToPoint must have an orientation so that the tool orientation coincides with the normal to the surface where the sphere is mounted. Thus, it is important to not only have a correct TCP but also tool orientation.
	At the position the robot starts spiral searches. First a number of coarse searches with relatively high speed.
	The coarse search pattern is a segmented spiral search, i.e. a spiral with linear movements. The height above the surface is constant but gradually decreased if no object is found. When the object is found, the robot regains and a new start position is calculated randomly ensuring that not the same contact position is used
Continues on next pa	nge

4.1.2 SearchSpJ - move joint search sphere *Continued*

twice. When four hits are established the coarse location of the sphere is set and four fine searches with low speed follows.

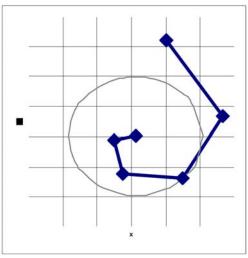

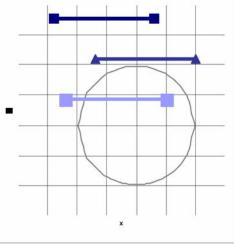

xx1400001414

Figure 4.1: Coarse search pattern - side view

xx1400001415

Figure 4.2: Coarse search pattern - top view

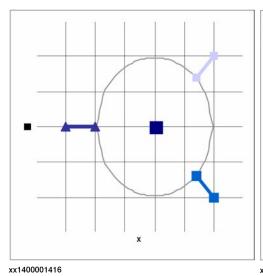


Figure 4.3: Fine search pattern - top view

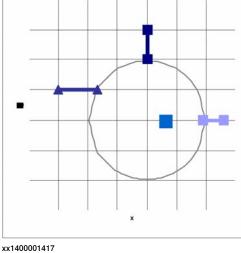


Figure 4.4: Fine search pattern - side view

Examples

```
! Data declarations
PERS robtarget ViaPoint1;
PERS robtarget ViaPoint2;
PERS robtarget rtNomPoint1;
PERS robtarget rtNomPoint2;
PERS robtarget rtResult1;
PERS robtarget rtResult2;
CONST navgeodata spData:=[6.35, 20.0];
VAR num nDist:=20;
nPERS tooldata tProbe;
```

27

4 RAPID references

4.1.2 SearchSpJ - move joint search sphere *Continued*

```
PROC CreateCalPoints ()
MoveJ ViaPoint1,v200,fine,tProbe;
SearchSpJ nDist, rtResult1, rtNomPoint1, v500, fine, tProbe,
    spData \SearchName:="CalPoint1";
MoveJ ViaPoint2,v200,fine,tProbe;
SearchSpJ nDist, rtResult2, rtNomPoint2, v500, fine, tProbe,
    spData \SearchName:="CalPoint2";
ENDPROC
```

Syntax

```
SearchSpJ
```

```
[ ApprDist ':=' ] < expression (IN) of num > ','
[ SearchPoint ':=' ] < expression (INOUT) of robtarget > ','
[ ToPoint ':=' ] < expression (PERS) of robtarget > ','
[ Speed ':=' ] < persistent (IN) of speeddata > ','
[ Tool ':=' ] < persistent (PERS) of tooldata >
[ '\' WObj ':=' < persistent (PERS) of wobjdata > ]
[ SphereData ':=' < expression (IN) of navgeodata > ]
[ '\' MeanError ':=' < expression (INOUT) of num > ]
[ '\' MaxError ':=' < expression (INOUT) of num > ]
[ '\' UpdateToPoint]
[ '\' SearchName ':=' < expression (IN) of string > ]
[ '\' TLoad ':=' ] < persistent (PERS) of loaddata > ] ';'
```

Related information

	Described in:
CalcRotAxisFrame	Technical reference manual - RAPID Instructions, Functions and Data types
DefAccFrame	Technical reference manual - RAPID Instructions, Functions and Data types

4.1.3 Measure_1D - one-dimensional measurement

Usage	
J	Measure_1D is an instruction used for tactile measurement of a coordinate perpendicular to its plane. The result is logged to database and the FlexPendant output window.
Basic example	Measure_1D p1, p2, v20, tProbe, 50, "ExampleMeasure";
	The robot moves linearly to p1 followed by a linear search towards the point p2. When contact is made the difference between p2 and the search position is logged and displayed.
Arguments	Measure_1D ApprPoint NominalPoint Speed Tool [\WObj] SetupRadius MeasureName [\Diff] [\Setup] [\TLoad]
ApprPoint	
	Data type: robtarget
	The approach point that should be as perpendicular as possible to the NominalPoint If the argument \SetupRadius is used a search algorithm will be performed to ensure that the approach point is perpendicular.
NominalPoint	
	Data type: robtarget
	The point where the robot expects to touch the feature. This robtarget is programmed so that the measurement tool is touching the surface of the feature.
Speed	
	Data type: speeddata
	The speed data used when moving to the approach point. The velocity of the search motion is unaffected.
Tool	
	Data type: tooldata
	The tool used during the measurement.
[\WObj]	
	Data type: wobjdata
	The work object used during the measurement. If not selected, $wobj0$ is used.
SetupRadius	
	Data type: num
	Only used if procedure is called from Production Manager Setup or switch Setup is set. Three additional measurements will be performed to define the plane the nominal point belongs to. The first measurement will be the NominalPoint and the other two will be at the given radius from NominalPoint. The plane defined

4.1.3 Measure_1D - one-dimensional measurement

Continues on next page

4 RAPID references

4.1.3 Measure_1D - one-dimensional measurement *Continued*

	from the measurements will be used to move the approach point ApprPoint so it becomes perfectly perpendicular to NominalPoint.	
MeasurementName		
	Data type: string	
	The measurement will be assigned this identifying name. The name will accompany logs and user dialogs.	
[\Diff]		
	Data type: num	
	The result of the search will be available in this optional argument, which corresponds to the absolute distance between the NominalPoint and the actual search point.	
[\Setup]		
	Data type: switch	
	Used to flag for setup if Production Manager is not used. If Production Manager is used this flag overrides the Production Manager state.	
[\TLoad]		
	Data type: loaddata	
	The \TLoad argument describes the total load used in the movement. The total load is the tool load together with the payload that the tool is carrying. If the \TLoad argument is used, then the loaddata in the current tooldata is not considered.	
	If the \TLoad argument is set to load0, then the \TLoad argument is not considered and the loaddata in the current tooldata is used instead. For a complete description of the TLoad argument, see MoveL in Technical reference manual - RAPID Instructions, Functions and Data types.	
Program execution		
Normal execution		
	The robot will make a linear movement to the position ApprPoint. The search equipment will be activated and motion will start towards the point to measure, NominalPoint. The robot will continue past the search point for a maximum total search distance twice the distance between ApprPoint and NominalPoint. Once the feature is sensed, motion stops, and the distance between NominalPoint and search position is logged and displayed on the FlexPendant. If the argument \UpdateNominal is used the NominalPoint will get the value of the search.	
Setup execution, cal	led from GAP Setup	
	The robot will make a linear movement to the position ApprPoint. The search equipment will be activated and three searches to define the plane the NominalPoint belongs to will be made.	
	1 Search towards NominalPoint.	
	2 Search towards a point at the distance SetupRadius from NominalPoint.	
	3 Search towards another point at the distance SetupRadius from	
	NominalPoint.	
Continues on next pa	age	

30

4.1.3 Measure_1D - one-dimensional measurement Continued


Common for the three searches are that the robot will continue past the search point for a maximum total search distance twice the distance between ApprPoint and NominalPoint. Once the feature is sensed, motion stops, robot backs up to start position.

After the plane has been defined the NominalPoint will be updated. ApprPoint will also be updated so it is perpendicular to NominalPoint. Thereafter the robot will perform the steps described in *Normal execution on page 30*.

More examples

Study the figure below where the grey area visualizes a plane.

An accurate measurement of the point NomPoint is to be made. It is desired to perform the measurement perpendicular to the plane due to that the search will be repeated and there exist a possibility that the plane will move between the repeated searches.

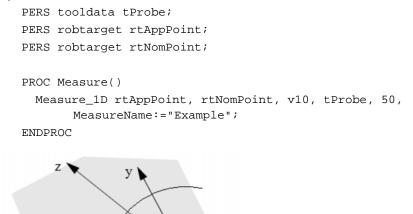

NomPoint

xx1400001418

Figure 4.5: Visualized plane

When the program is executed from GAP Setup four different searches will be performed.

1 First search towards rtNomPoint.

SetupRadius

- 2 Search towards point 50 mm from rtNomPoint.
- 3 Another search towards point 50mm from rtNomPoint.
- 4 Final search for rtNomPoint. The search will be performed perfectly perpendicular to the plane rtNomPoint belongs to.

Syntax

```
Measure_1D
```

```
[ ApprPoint ':=' ] < expression (INOUT) of robtarget > ','
[ NominalPoint ':=' ] < expression (INOUT) of robtarget > ','
```

31

4 RAPID references

4.1.3 Measure_1D - one-dimensional measurement *Continued*

```
[ Speed ':=' ] < expression (IN) of speeddata > ','
[ Tool ':=' ] < persistent (PERS) of tooldata >
[ '\' WObj ':=' < persistent (PERS) of wobjdata > ] ','
[ SetupRadius expression (IN) of num] ','
[ MeasureName ':=' < expression (IN) of string > ] ','
[ '\' Diff ':=' < expression (INOUT) of num > ]
[ '\' TLoad ':=' ] < persistent (PERS) of loaddata > ] ';'
```

Related information

	Described in:
CalcRotAxisFrame	Technical reference manual - RAPID Instructions, Functions and Data types
DefAccFrame	Technical reference manual - RAPID Instructions, Functions and Data types
MoveL	Technical reference manual - RAPID Instructions, Functions and Data types
Definition of loaddata	Technical reference manual - RAPID Instructions, Functions and Data types

4.2.1 navgeodata - Navigator geometrical data

4.2 Data types

4.2.1 navgeodata - Navigator geometrical data

Usage	
9-	navgeodata defines the radius of the tooling ball to search for and the search radius.
	Navigator is a set of functions for defining calibration points automatically and for quality control measurements. Navgeodata is used to describe the calibration point feature.
Basic example	
	VAR navgeodata ToolBall:=[6.35, 20.0];
	The exact position of a tooling ball should be defined using Navigator. The tooling ball has a radius of 6.35 mm and its position is known within +/-20 mm.
Components	
SphereRad	
	Data type: num
	Radius of the cell mounted sphere.
SearchOffset	
	Data type: num
	Maximum error of the nominal position to search for. If the nominal position in relatively accurately known a small <code>SearchOffset</code> will give faster cycle time.
Structure	
	<dataobject navgeodata="" of=""></dataobject>
	<sphererad num="" of=""></sphererad>
	<searchoffset num="" of=""></searchoffset>

Related information

	Described in:
Linear sphere search	SearchSpL - move linear search sphere on page 21
Joint sphere search	SearchSpJ - move joint search sphere on page 25

This page is intentionally left blank

Index

В

batch supervision, 18

С

calibration, 15 calibration, fixture/workobject, 17 calibration, rotational axis, 16 cloning fixtures, 18 coordinate measurements, 18

D

data types, 33

F

fixture/workobject calibration, 17 fixture cloning, 18

I

I/O installation, 13 instructions, 21

Ľ

license, 14

Μ

Measure_1D, 29

Ν

navgeodata, 33 Navigator, description, 11

Ρ

prerequisites, hardware, 11 prerequisites, system, 11 prerequisites, user, 11

R

rotational axis calibration, 16

S

safety, 10 search sensitivity, 13 SearchSpJ, 25 SearchSpL, 21 software, loading, 14 system parameters, 13

Contact us

ABB AB **Discrete Automation and Motion** Robotics S-721 68 VÄSTERÅS, Sweden Telephone +46 (0) 21 344 400

ABB AS, Robotics **Discrete Automation and Motion** Nordlysvegen 7, N-4340 BRYNE, Norway Box 265, N-4349 BRYNE, Norway Telephone: +47 51489000

ABB Engineering (Shanghai) Ltd. No. 4528 Kangxin Hingway PuDong District SHANGHAI 201319, China Telephone: +86 21 6105 6666

www.abb.com/robotics



